




SRK Condensing Unit (field connected)

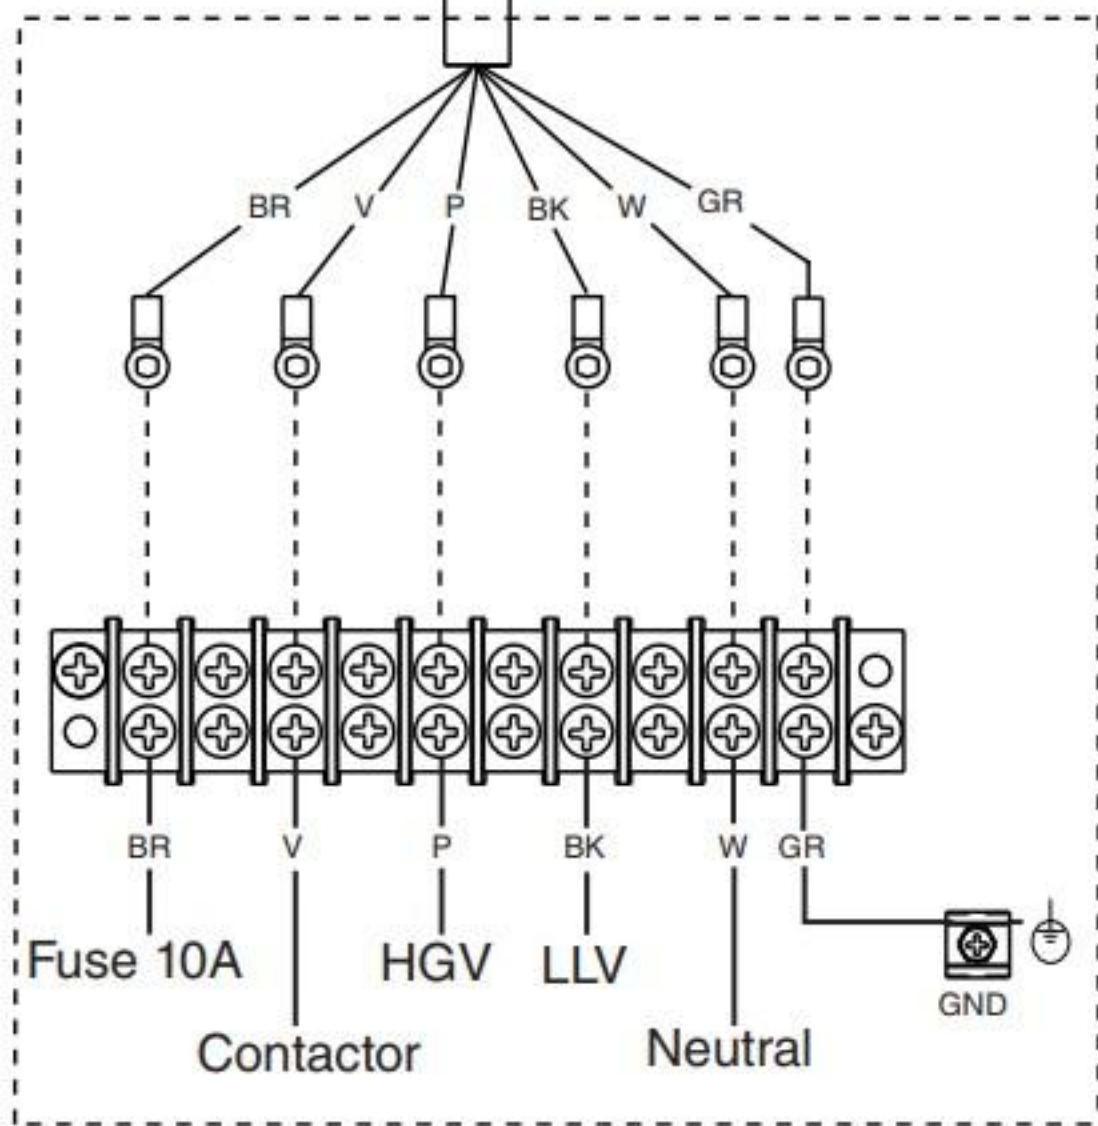

KMS Icemaker Unit (factory connected)

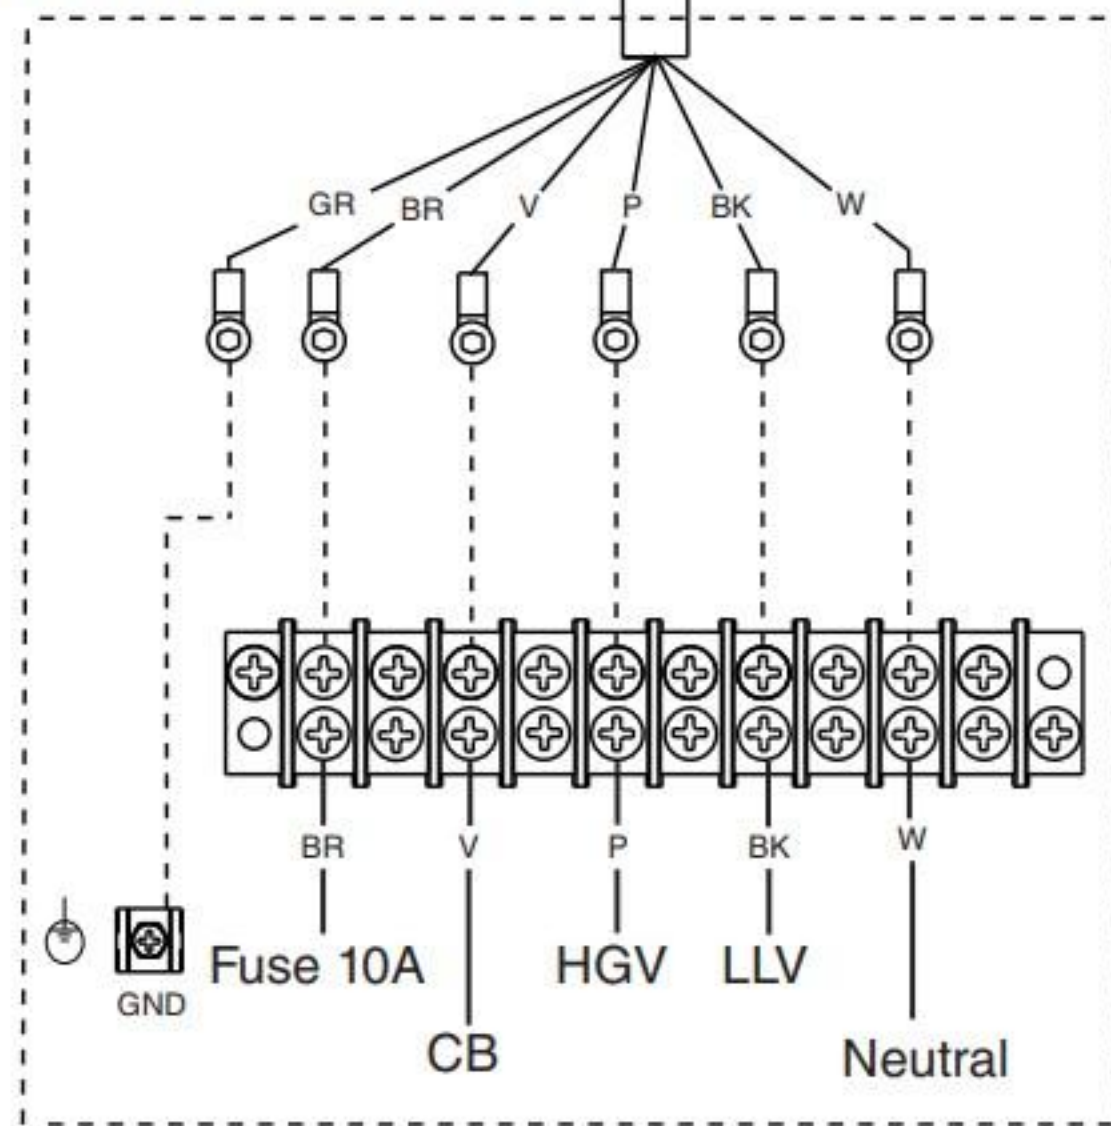

SRK (1 PHASE)

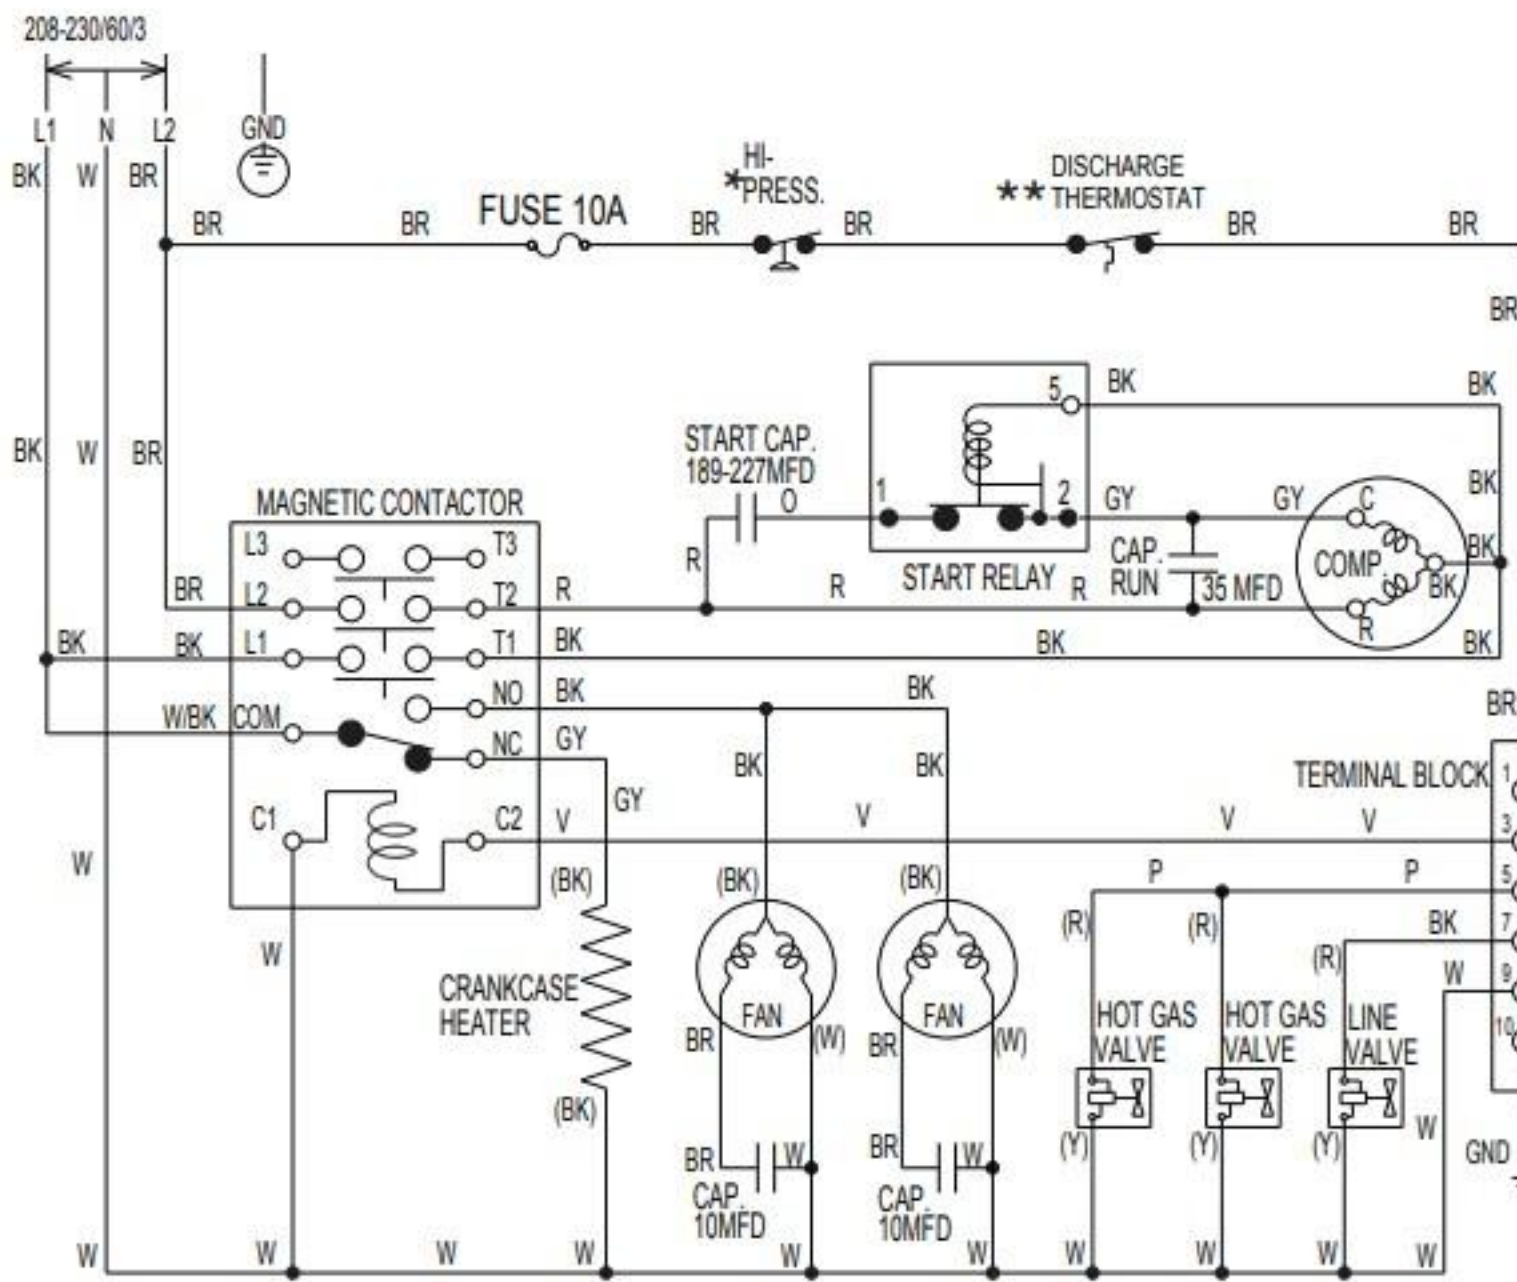


X10 WV1 AND WV2 RELAY
X11 DRAIN VALVE/HARVEST PUMP TIMER RELAY
X12 DRAIN VALVE LOCKOUT RELAY 1
X13 DRAIN VALVE LOCKOUT RELAY 2


S4 DIP SWITCH SETTING	No.1	No.2	No.3	No.4	No.5	No.6	No.7	No.8	No.9	No.10
KMS-1402MLJ	OFF	OFF	OFF	ON	ON	ON	ON	OFF	OFF	OFF

S5 DIP SWITCH SETTING	No.1	No.2	No.3	No.4	No.5
KMS-1402MLJ	ON	ON	OFF	OFF	OFF

WIRE COLOR CODE
BK -BLACK
BR -BROWN
DBU -DARK BLUE
GR -GREEN
GY -GRAY
O -ORANGE
P -PINK
R -RED
V -VIOLET
W -WHITE
Y -YELLOW
W/BR -WHITE/BROWN
W/R -WHITE/RED
W/BK -WHITE/BLACK
W/O -WHITE/ORANGE
W/BU -WHITE/BLUE

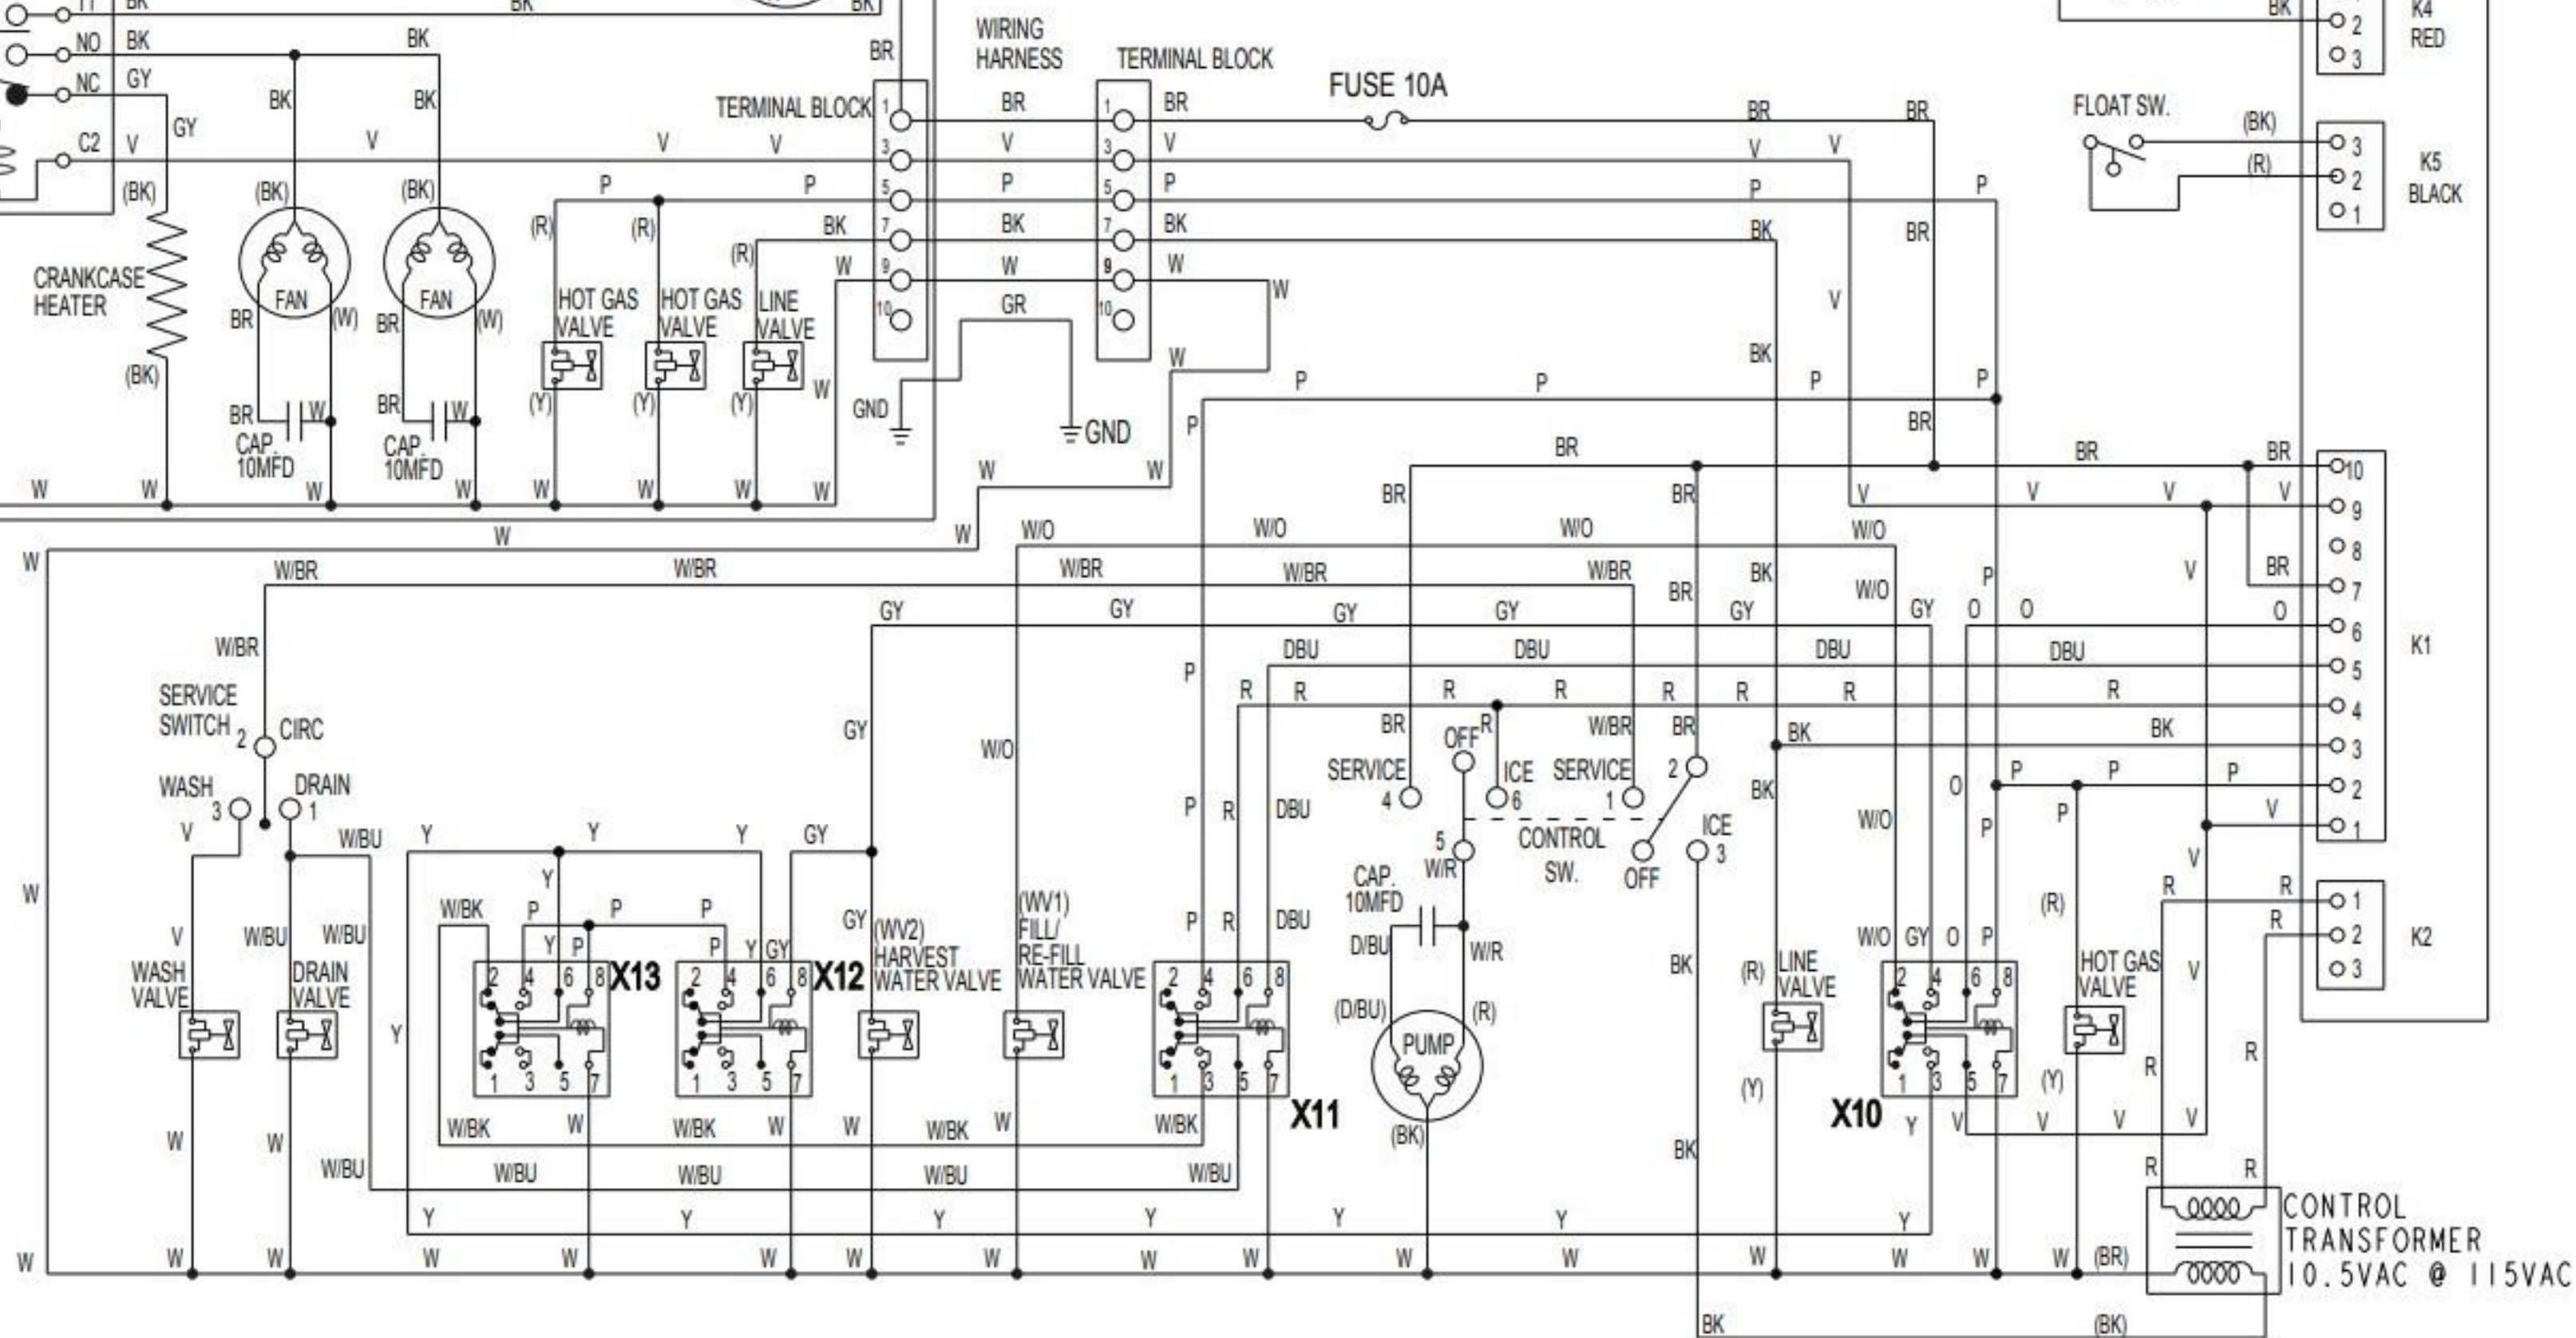


SRK (3 PHASE)

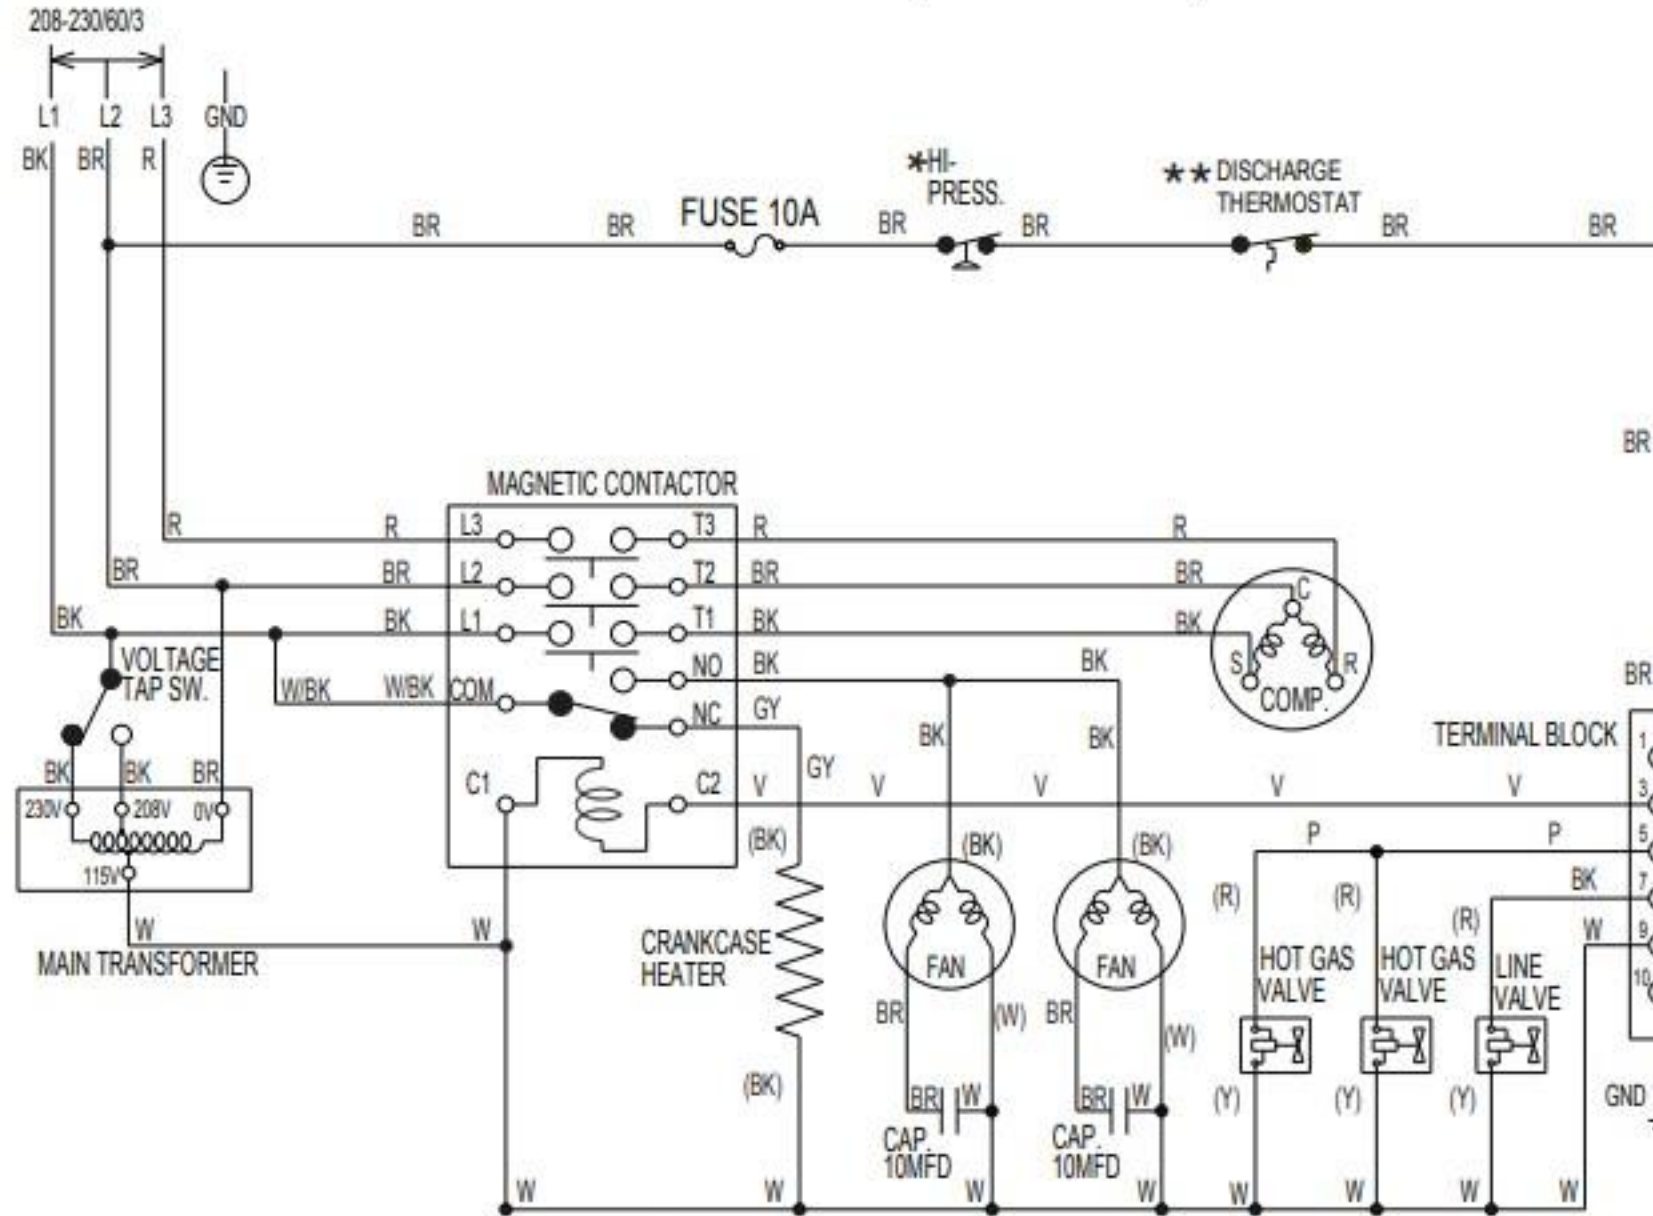

X10 WV1 AND WV2 RELAY
X11 DRAIN VALVE/HARVEST PUMP TIMER RELAY
X12 DRAIN VALVE LOCKOUT RELAY 1
X13 DRAIN VALVE LOCKOUT RELAY 2

S4 DIP SWITCH SETTING	No.1	No.2	No.3	No.4	No.5	No.6	No.7	No.8	No.9	No.10
KMS-1402MLJ	OFF	OFF	OFF	ON	ON	ON	ON	OFF	OFF	OFF

S5 DIP SWITCH SETTING	No.1	No.2	No.3	No.4	No.5
KMS-1402MLJ	ON	ON	OFF	OFF	OFF

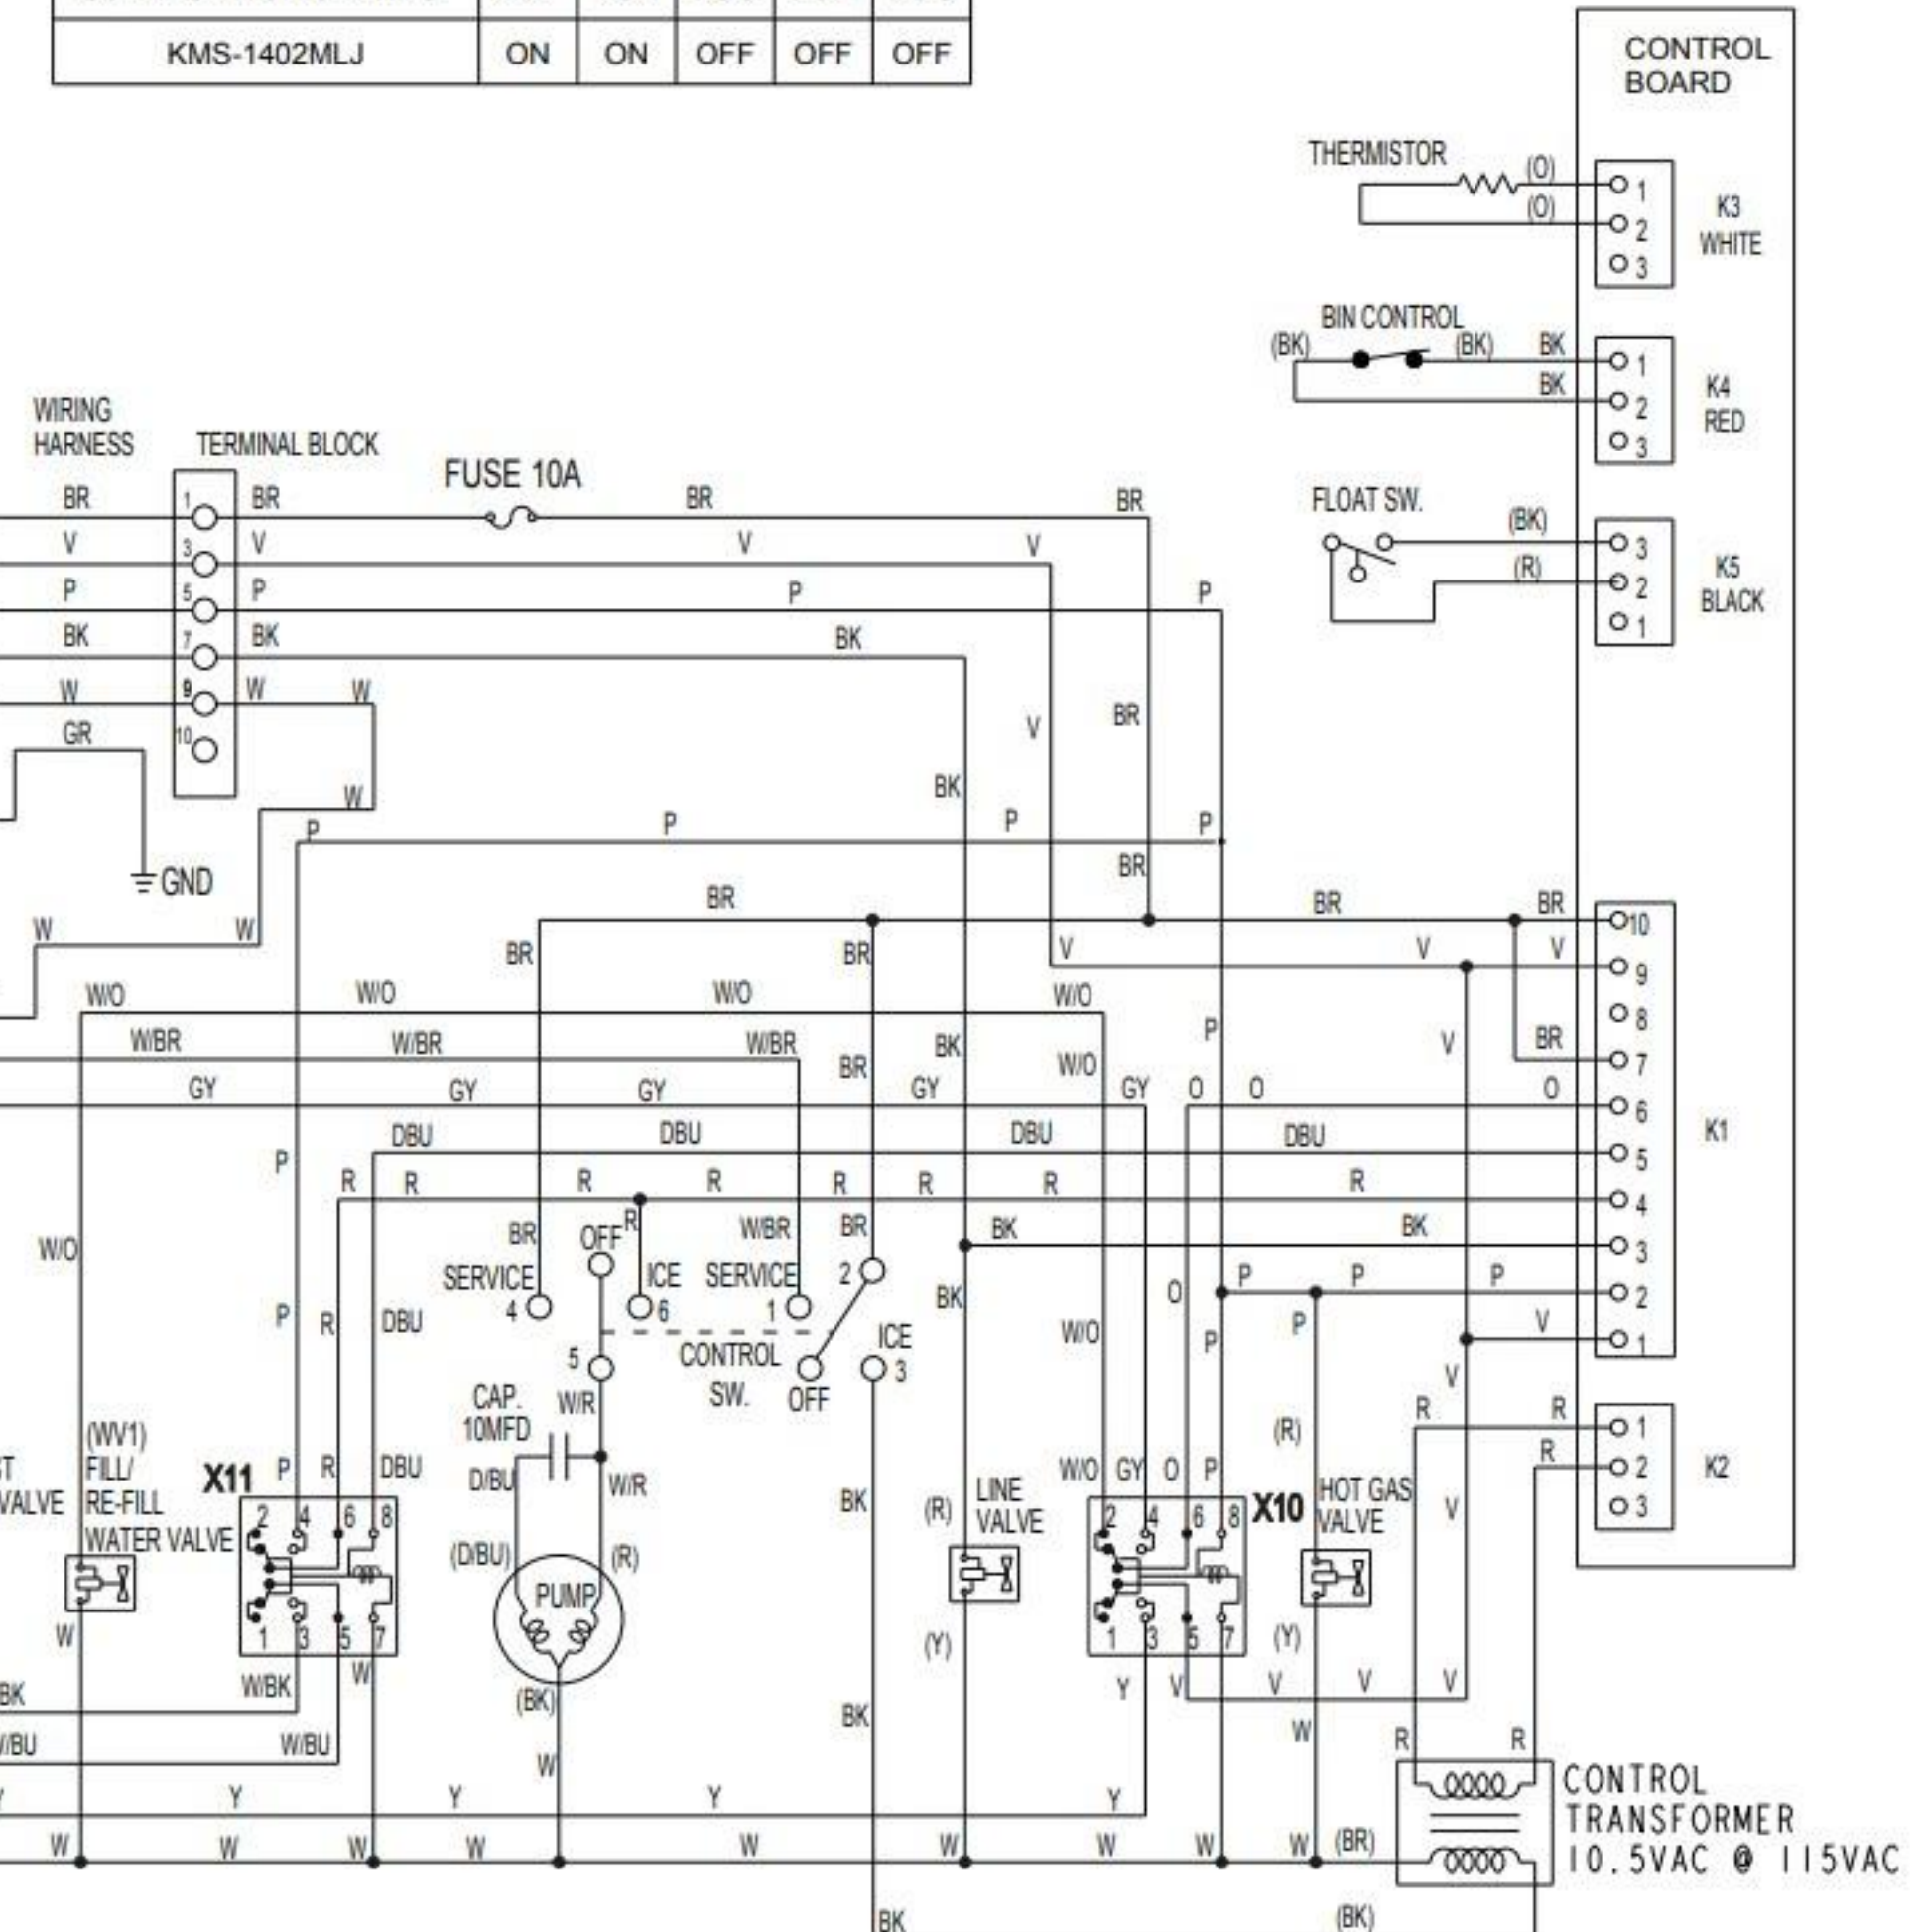

WIRE COLOR CODE
BK -BLACK
BR -BROWN
DBU-DARK BLUE
GR -GREEN
GY -GRAY
O -ORANGE
P -PINK
R -RED
V -VIOLET
W -WHITE
Y -YELLOW
W/BR -WHITE/BROWN
W/R -WHITE/RED
W/BK -WHITE/BLACK
W/O -WHITE/ORANGE
W/BU -WHITE/BLUE